



100 Thomas Johnson Drive, Frederick, MD 21702-4600 USA Phone (301) 663-1600 • 1-800-638-3326 Fax (301) 663-1607 • 1-800-447-3326 Website: www.edcoinc.com • Email: sales@edcoinc.com

Printed in USA ©2001 READ AND UNDERSTAND THE OPERATORS INSTRUCTION MANUAL THOROUGHLY BEFORE ATTEMPTING TO OPERATE THIS EQUIPMENT. Death or serious injury could occur if this machine is used improperly.

SAFETY MESSAGES

The safety instructions are proceeded by a graphic alert message of DANGER, WARNING, or CAUTION.



Indicates an imminent hazard which, if not avoided, will result in death or serious injury.



Indicates an imminent hazard which, if not avoided, will result in death or serious injury.



Indicates hazards which, if not avoided, could result in serious injury and or damage to the equipment.

GASOLINE Powered Equipment



• Do not operate gasoline powered equipment without adequate ventilation. Carbon monoxide is an invisible, odorless gas that can kill.

ELECTRICAL — Powered Equipment



• ELECTRICAL HAZARD - Be sure equipment is properly grounded. Failure to comply could kill or result in serious injury.



WARNING

The engine exhaust from this product contains chemicals known to the State of California to cause cancer, birth defects or other reproductive harm.

GENERAL INSTRUCTIONS

- You must read and understand the operators instruction manual and all other manuals associated with this machine. For your safety and the safety of others around you, it is extremely important to fully understand how to operate this machine in the way it was intended. Different model machines or older/newer versions of the same model may have different parts and controls that you need to understand. If instructions are not readable or available DO NOT USE this machine and contact the factory for a replacement Manual.
- You must be able to physically handle the bulk weight and power of this machine. If not properly controlled this machine can cause death or serious injury.
- Do not operate this machine in an impaired mental state. You must be able to exercise good judgement and reactions to maintain a safe working environment.
- This is a "one person" machine which means only one operator can be operating the machine at any one time. For the safety of others, maintain a safe operating distance to other personnel. Your work area should be defined and appropriately marked so bystanders and coworkers do not stand or walk near this machine and end up seriously injured by flying debris or exposing them to harmful noise or dust.
- This equipment is for Commercial use. Although this is a "one person" machine your work team should understand how to shut this machine off and quickly get medical help if an accident strikes the operator.
- Keep all guards in place during operation. The guards are to provide protection from inadvertent contact with dangerous moving parts, pinch points, or hot surfaces.
- Wear appropriate Personal Protective Equipment (PPE) including safety glasses, safety boots, work gloves, respiratory protection,


hearing protection, and head protection. Do not wear loose clothing that can get tangled in moving parts. Failure to do so could result in dismemberment or death. Wear an approved respirator when removing hazardous materials or when grinding/cutting dry materials. Some dust particles such as concrete dust can contain silicate particles which can cause silicosis (a very serious lung disease). Contact NIOSH or OSHA for further details. When wet grinding/ cutting, avoid contact with the concrete/asphalt slurry which can cause serious skin irritations.

CAUTION

- You must maintain this machine per the maintenance schedule in the operator manual. Remember before adjusting, servicing, or fueling this machine, disconnect the source of power to the machine by disconnecting the spark plug (Gas models), or by unplugging the electrical power cord (electric models) or air hose (Pneumatic models) AT THE MACHINE so you can assure yourself it remains unplugged while you are working on it. Do not modify this machine. Use only genuine EDCO parts and accessories. Repairs and service should be performed by approved EDCO dealers or authorized technicians.
- You should look carefully around the area before you begin work so you can identify potential hazards such as deck inserts, pipes, columns, openings, electrical cords or outlets, or any other objects protruding from the slab surface.
- This machine has no brain so you must use your own. There is no substitute for safety. The safety decals on the machine are to serve as a reminder for information you must already know before you begin using this machine. Take a moment to reread the safety decals each time you use the machine. If your machine is missing any decals, contact the factory for a replacement (EDCO 1-800-638-3326).

MODEL EDG-7

EDGE GRINDER DIMENSIONS

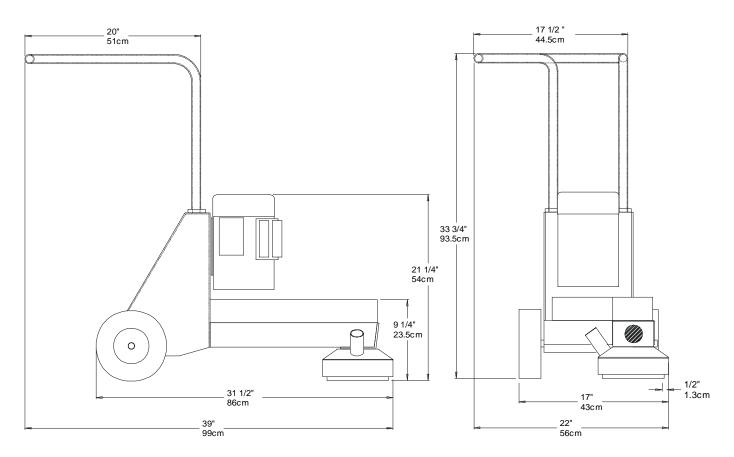

EDGE GRINDER WEIGHT = 123 lbs / 55.8 kg

HOW TO ORDER REPLACEMENT PARTS


To insure product safety and reliability, always use genuine EDCO replacement parts when making repairs to the equipment.

□ When calling for parts, specify the MODEL and SERIAL NUMBER of the machine which can be found on the NAME PLATE. Keep that information in the space provided. In addition to this information, give part number, description and quantity as listed on the parts list to your parts representative.

□ Please note: Due to improvements and changes in the equipment, the illustrations shown may be different than the actual machine.

FILL IN INFORMATION BELOW					
Date of Purchase					
Name of Machine					
Model #					
Serial #					
Belt Size(s)					
Toll Free: 1-800-638-3326 FAX: 1-800-447-3326 email: sales@edcoinc.com www.edcoinc.com					

ILLUSTRATION #1 - MAIN ASSEMBLY GROUPING

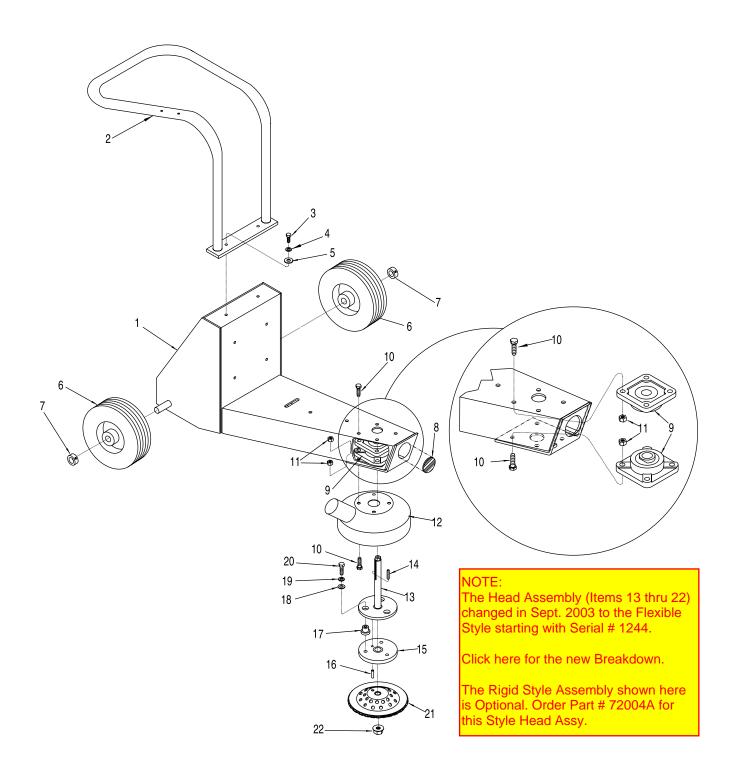


PARTS LISTING - ILLUSTRATION # 1: MAIN ASSEMBLY GROUPING

ITEM#	PART #	DESCRIPTION	QTY.
1	72001	MAIN FRAME	1
2	72002	HANDLE BAR	1
3	10055	SCREW, CAP 3/8-18 x 1	2
4	10811	WASHER, LOCK 3/8	2
5	10025	WASHER, FLAT 3/8	2
6	79013	WHEEL, 8 x 2-1/2 x 3/4" BRG.	2
7	10428	COLLAR, LOCKING 3/4" ID	2
8	65021	CAP, PLUG 2"	1
9	77009	BEARING, BALL 3/4" 4-HOLE FLANGE	2
10	10309	SCREW, CAP 3/8-24 x 1-1/4	8
11	10152	NUT, HEX NYLON LOCK 3/8-24	8
12	72009	COVER, DISC	1
13	72004	DIAMOND HEAD FLANGE & SHAFT	1
14	10016	KEY 3/16 SQ. x 1-1/2	1
15	72005	DIAMOND DISC MOUNTING FLANGE	1
16	10049	PIN, ROLL 1/4 x 1	1
17	72007	MOUNT, CENTER BONDED (CB-1120)	3
18	72006	WASHER, CENTER BONDED MOUNT	3
19	10811	WASHER, LOCK 3/8	3
20	10309	SCREW, CAP 3/8-24 x 1-1/4	3
21	72030	7EDCW DIAMOND CUP WHEEL 7"	1
22	72021	NUT, FLANGE 5/8-11	1

E-EDG7-PL-0401

ILLUSTRATION # 2 - MOTOR GROUPING

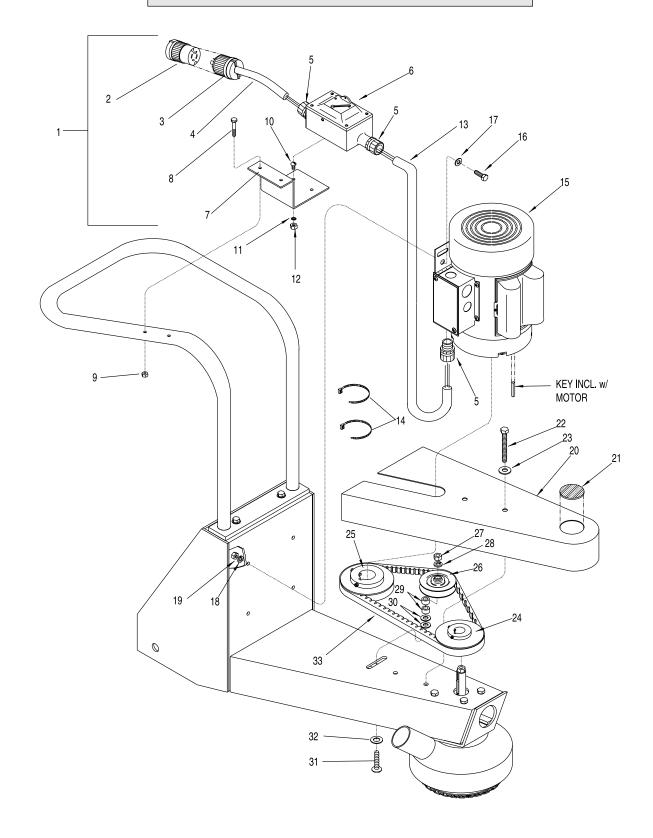

ITEM # PART # DESCRIPTION QTV. 1 72013 SWITCH & WIRE HARNESS ASSEMBLY (2-13) 1 2 40041 PLUG CONNECTOR, LOCKING 20A/125V 1 3 40042 PLUG, LOCKING 20A/125V 1 4 77026 WIRE HARNESS 12/3 x 18" LOA 1 5 41130 CONN., STRAIN RELIEF 1/2 NPT x.555650" 3 6 77027 SWITCH w/ ENCLOSURE DP 30A 120-277V 1 7 72011 BRACKET, SWITCH BOX 1 8 10315 SCREW, CAP 1/4-20 x 1-1/2 2 9 10150 NUT, HEX NYLON LOCK 1/4-20 2 10 10365 BOLT, CARRIAGE 10-24 x 1/2 2 11 10831 WASHER, LOCK, INT. TOOTH # 10 2 12 10463 NUT 10-24 2 13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16	PARTS	PARTS LISTING - ILLUSTRATION # 2: MOTOR GROUPING					
2 40041 PLUG CONNECTOR, LOCKING 20A/125V 1 3 40042 PLUG, LOCKING 20A/125V 1 4 77026 WIRE HARNESS 12/3 x 18" LOA 1 5 41130 CONN., STRAIN RELIEF 1/2 NPT x 555650" 3 6 77027 SWITCH #/ ENCLOSURE DP 30A 120-277V 1 7 72011 BRACKET, SWITCH BOX 1 8 10315 SCREW, CAP 1/4-20 x 1-1/2 2 9 10150 NUT, HEX NYLON LOCK 1/4-20 2 10 10365 BOLT, CARRIAGE 10-24 x 1/2 2 11 10831 WASHER, LOCK, INT. TOOTH # 10 2 12 10463 NUT 10-24 2 13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801	ITEM #	PART#	DESCRIPTION	QTY.			
3 40042 PLUG, LOCKING 20A/125V 1 4 77026 WIRE HARNESS 12/3 x 18" LOA 1 5 41130 CONN., STRAIN RELIEF 1/2 NPT x .555650" 3 6 77027 SWITCH w/ ENCLOSURE DP 30A 120-277V 1 7 72011 BRACKET, SWITCH BOX 1 8 10315 SCREW, CAP 1/4-20 x 1-1/2 2 9 10150 NUT, HEX NYLON LOCK 1/4-20 2 10 10365 BOLT, CARRIAGE 10-24 x 1/2 2 11 10831 WASHER, LOCK, INT. TOOTH # 10 2 12 10463 NUT 10-24 2 2 13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054<	1	72013	SWITCH & WIRE HARNESS ASSEMBLY (2-13)	1			
4 77026 WIRE HARNESS 12/3 x 18" LOA 1 5 41130 CONN., STRAIN RELIEF 1/2 NPT x .555.650" 3 6 77027 SWITCH w/ ENCLOSURE DP 30A 120-277V 1 7 72011 BRACKET, SWITCH BOX 1 8 10315 SCREW, CAP 1/4-20 x 1-1/2 2 9 10150 NUT, HEX NYLON LOCK 1/4-20 2 10 10365 BOLT, CARRIAGE 10-24 x 1/2 2 11 10831 WASHER, LOCK, INT. TOOTH # 10 2 12 10463 NUT 10-24 2 13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, IOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT </td <td>2</td> <td>40041</td> <td>PLUG CONNECTOR, LOCKING 20A/125V</td> <td>1</td>	2	40041	PLUG CONNECTOR, LOCKING 20A/125V	1			
5 41130 CONN., STRAIN RELIEF 1/2 NPT x.555650" 3 6 77027 SWITCH w/ ENCLOSURE DP 30A 120-277V 1 7 72011 BRACKET, SWITCH BOX 1 8 10315 SCREW, CAP 1/4-20 x 1-1/2 2 9 10150 NUT, HEX NYLON LOCK 1/4-20 2 10 10365 BOLT, CARRIAGE 10-24 x 1/2 2 11 10831 WASHER, LOCK, INT. TOOTH # 10 2 12 10463 NUT 10-24 2 13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, ICAC 5/16 4 18 10801 WASHER, ICAC 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD)	3	40042	PLUG, LOCKING 20A/125V	1			
6 77027 SWITCH w/ ENCLOSURE DP 30A 120-277V 1 7 72011 BRACKET, SWITCH BOX 1 8 10315 SCREW, CAP 1/4-20 x 1-1/2 2 9 10150 NUT, HEX NYLON LOCK 1/4-20 2 10 10365 BOLT, CARRIAGE 10-24 x 1/2 2 11 10831 WASHER, LOCK, INT. TOOTH # 10 2 12 10463 NUT 10-24 2 13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, ICCK 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) <td< td=""><td>4</td><td>77026</td><td>WIRE HARNESS 12/3 x 18" LOA</td><td>1</td></td<>	4	77026	WIRE HARNESS 12/3 x 18" LOA	1			
7 72011 BRACKET, SWITCH BOX 1 8 10315 SCREW, CAP 1/4-20 x 1-1/2 2 9 10150 NUT, HEX NYLON LOCK 1/4-20 2 10 10365 BOLT, CARRIAGE 10-24 x 1/2 2 11 10831 WASHER, LOCK, INT. TOOTH # 10 2 12 10463 NUT 10-24 2 13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr. Bx 3/4" BORE 1	5	41130	CONN., STRAIN RELIEF 1/2 NPT x .555650"	3			
8 10315 SCREW, CAP 1/4-20 x 1-1/2 2 9 10150 NUT, HEX NYLON LOCK 1/4-20 2 10 10365 BOLT, CARRIAGE 10-24 x 1/2 2 11 10831 WASHER, LOCK, INT. TOOTH # 10 2 12 10463 NUT 10-24 2 13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 </td <td>6</td> <td>77027</td> <td>SWITCH w/ ENCLOSURE DP 30A 120-277V</td> <td>1</td>	6	77027	SWITCH w/ ENCLOSURE DP 30A 120-277V	1			
9 10150 NUT, HEX NYLON LOCK 1/4-20 2 10 10365 BOLT, CARRIAGE 10-24 x 1/2 2 11 10831 WASHER, LOCK, INT. TOOTH # 10 2 12 10463 NUT 10-24 2 13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1Gr.B x 7/8" BORE	7	72011	BRACKET, SWITCH BOX	1			
10 10365 BOLT, CARRIAGE 10-24 x 1/2 2 11 10831 WASHER, LOCK, INT. TOOTH # 10 2 12 10463 NUT 10-24 2 13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 7/8" BORE 1 25 72012 SHEAVE 4" OD x 1Gr.B x 7/8" BORE 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8"	8	10315	SCREW, CAP 1/4-20 x 1-1/2	2			
11 10831 WASHER, LOCK, INT. TOOTH # 10 2 12 10463 NUT 10-24 2 13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 1 28 10811 WASHER, LOCK 3/8 1 1 29 10011 SPACER, STEEL 5/8" OD x	9	10150	NUT, HEX NYLON LOCK 1/4-20	2			
12 10463 NUT 10-24 2 13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1 Gr. AB x 3/8" BEARING 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 1 28 10811 WASHER, LOCK 3/8 1 2 30 10025 WASHER, FLAT 3/	10	10365	BOLT, CARRIAGE 10-24 x 1/2	2			
13 72014 WIRE HARNESS 12/3 x 32" LOA 1 14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1 Gr. AB x 3/8" BEARING 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 1 28 10811 WASHER, LOCK 3/8 1 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 </td <td>11</td> <td>10831</td> <td>WASHER, LOCK, INT. TOOTH # 10</td> <td>2</td>	11	10831	WASHER, LOCK, INT. TOOTH # 10	2			
14 10982 TIE, NYLON, BLACK 7-1/2" 2 15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1 Gr. B x 3/8" BEARING 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 1 28 10811 WASHER, LOCK 3/8 1 2 30 10025 WASHER, FLAT 3/8 2 3 30 10025 WASHER, FLAT 3/8 2 3 31 10908 </td <td>12</td> <td>10463</td> <td>NUT 10-24</td> <td>2</td>	12	10463	NUT 10-24	2			
15 16037 MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM 1 16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1Gr.B x 3/8" BEARING 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 1 28 10811 WASHER, LOCK 3/8 1 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040	13	72014	WIRE HARNESS 12/3 x 32" LOA	1			
16 10806 SCREW, CAP 5/16-18 x 1 4 17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1Gr.B x 7/8" BORE 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 1 28 10811 WASHER, LOCK 3/8 1 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	14	10982	TIE, NYLON, BLACK 7-1/2"	2			
17 10213 WASHER, FLAT 5/16 4 18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1Gr.B x 7/8" BORE 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 1 28 10811 WASHER, LOCK 3/8 1 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 1 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	15	16037	MOTOR, LEESON 2HP-1PH 60Hz 1740 RPM	1			
18 10801 WASHER, LOCK 5/16 4 19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1Gr.B x 7/8" BORE 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 1 28 10811 WASHER, LOCK 3/8 1 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	16	10806	SCREW, CAP 5/16-18 x 1	4			
19 10054 NUT 5/16-18 4 20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1Gr.B x 7/8" BORE 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 28 10811 WASHER, LOCK 3/8 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	17	10213	WASHER, FLAT 5/16	4			
20 72003 COVER, BELT 1 21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1Gr.B x 7/8" BORE 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 28 10811 WASHER, LOCK 3/8 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	18	10801	WASHER, LOCK 5/16	4			
21 65021 PLUG, CAP 2" 1 22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1Gr.B x 7/8" BORE 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 28 10811 WASHER, LOCK 3/8 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	19	10054	NUT 5/16-18	4			
22 52015 BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD) 2 23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1Gr.B x 7/8" BORE 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 28 10811 WASHER, LOCK 3/8 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	20	72003	COVER, BELT	1			
23 10025 WASHER, FLAT 3/8 2 24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1Gr.B x 7/8" BORE 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 28 10811 WASHER, LOCK 3/8 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	21	65021	PLUG, CAP 2"	1			
24 72010 SHEAVE 4" OD x 1Gr.B x 3/4" BORE 1 25 72012 SHEAVE 4" OD x 1Gr.B x 7/8" BORE 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 28 10811 WASHER, LOCK 3/8 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	22	52015	BOLT, TAP 3/8-16 x 3-1/2 (FULL THREAD)	2			
25 72012 SHEAVE 4" OD x 1Gr.B x 7/8" BORE 1 26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 28 10811 WASHER, LOCK 3/8 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	23	10025	WASHER, FLAT 3/8	2			
26 50115 PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING 1 27 10404 NUT 3/8-16 1 28 10811 WASHER, LOCK 3/8 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	24	72010	SHEAVE 4" OD x 1Gr.B x 3/4" BORE	1			
27 10404 NUT 3/8-16 1 28 10811 WASHER, LOCK 3/8 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	25	72012	SHEAVE 4" OD x 1Gr.B x 7/8" BORE	1			
28 10811 WASHER, LOCK 3/8 1 29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	26	50115	PULLEY, IDLER 3" OD x 1 Gr. AB x 3/8" BEARING	1			
29 10011 SPACER, STEEL 5/8" OD x 3/8" ID x 3/8" 2 30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	27	10404	NUT 3/8-16	1			
30 10025 WASHER, FLAT 3/8 2 31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	28	10811	WASHER, LOCK 3/8	1			
31 10908 BOLT, CARRIAGE 3/8-16 x 2-1/2 1 32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	29	10011	SPACER, STEEL 5/8" OD x 3/8" ID x 3/8"	2			
32 10040 WASHER, GARRETT 1"OD x 17/32" ID x .054 THK. 1	30	10025	WASHER, FLAT 3/8	2			
	31	10908	BOLT, CARRIAGE 3/8-16 x 2-1/2	1			
	32	10040	WASHER, GARRETT 1"OD x 17/32" ID x .054 THK	. 1			
33 10278 BELI, BX-34 COG 1	33	10278	BELT, BX-34 COG	1			

LIMITED EQUIPMENT WARRANTY

Equipment Development Company, Inc. herein referred to as EDCO warrants that each new unit manufactured by EDCO to be free from defects in material and workmanship in normal use and service for a period of (1) one year (except in the case of the cutter drum assembly on all model concrete asphalt planes, in which case the warranty period shall be 90 days) from date of shipment to the original retail or equipment rental center owner.

EDCO will, at its option, repair or replace, at the EDCO factory or at a point designated by EDCO any part, which shall appear to the satisfaction of EDCO inspection to have been defective in material or workmanship.

This warranty, does not apply to failure occurring as a result of abuse, misuse, negligent repairs, corrosion, erosion, normal wear and tear, alterations or modifications made to the product without express written consent of EDCO: or failure to follow the recommended operating practices and maintenance procedures as provided in the products operating and maintenance manuals.

This warranty does not obligate EDCO to bear any transportation charges in connection with the replacement or repair of defective parts. This warranty does not obligate EDCO to bear any expense for travel time or of personnel in connection with any service calls.

Accessories or equipment furnished and installed on the product by EDCO but manufactured by others, including but not limited to engines, motors, electrical equipment, transmissions, etc., shall carry the accessory manufacturers' own warranty.

THIS WARRANTY IS IN LIEU OF ALL OTHER WAR-RANTIES, EXPRESSED OR IMPLIED, OR STATU-TORY, INCLUDING ANY WARRANTIES OF MER-CHANTABILITY OR OF FITNESS FOR A PARTICU-LAR PURPOSE.

LIABILITY LIMITATIONS

The remedies of the user set forth under provisions of warranty outlined above are the exclusive and total liability of EDCO with the respect to their sale or the equipment and service furnished hereunder, in connection with the performance or breach thereof, or from the sale, delivery, installation, repair or technical direction covered by or furnished under the sale, whether based on contract, warranty, negligence, indemnity, strict liability, or otherwise shall not exceed the purchase price of the unit of equipment upon which such liability is based.

EDCO will not in any event be liable to the user, any successors in interest or any beneficiary or assignee relating to this sale for any consequential, incidental, indirect, special or punitive damages arising out of this sale or any breach thereof, or any defects on, or failure of, or malfunction of the equipment under this sale based upon loss of use, lost profits or revenue, interest, lost goodwill, work stoppage, impairment of other goods, loss by reason of shutdown or non-operation, increased expenses of operation of the equipment, cost of purchase or replacement power of claims of users or customers of the user for service interruption whether or not such loss or damage is based on contract, warranty, negligence, indemnity, strict liability, or otherwise.


EDCO reserves the right to modify, alter and improve any part or parts without incurring any obligation to replace any part or parts previously sold without such modified, altered or improved part or parts.

No person is authorized to give any other warranty or to assume any additional obligation on EDCO's behalf unless made in writing and signed by an officer of EDCO.

Equipment Development Company, Inc.

USE ONLY GENUINE EDCO PARTS AND ACCESSORIES For your own safety, the safety of others and the life of your machine



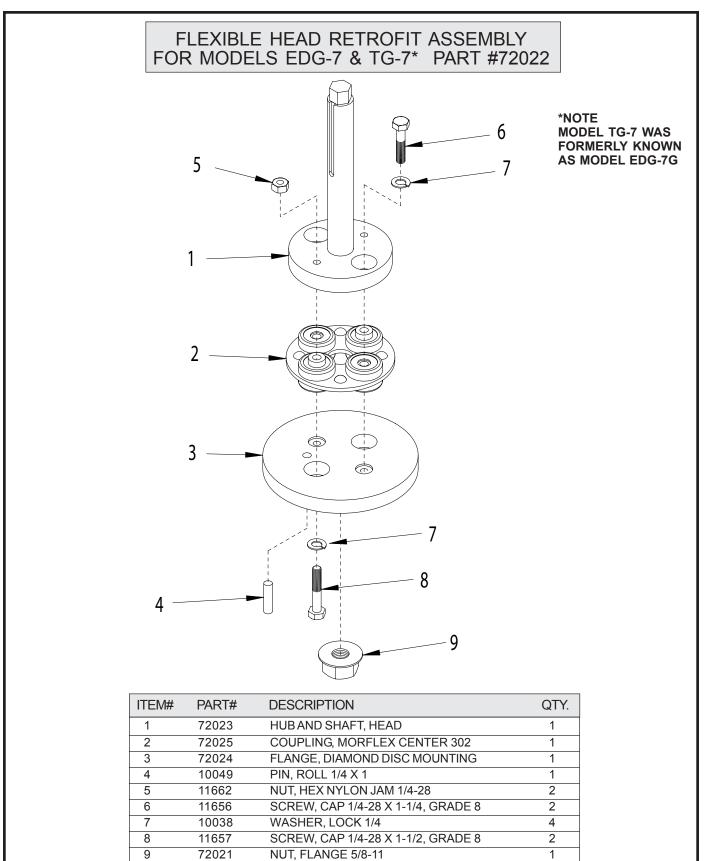



Printed in USA ©2004